PDM 32

All names in this document have the type in capitals as the last characters in the name.

StartStopDI is a Digital Input.

StrtEng SV is a Status Variable.


Starter O is an Output.

Start/Run engine button


This document explains how to set a Start/Run button on the pdm32.

The starter needs to be connected to High Power 1 connector.

In this example Digital input 9 (StartRun DI)will connect to ground to turn on .

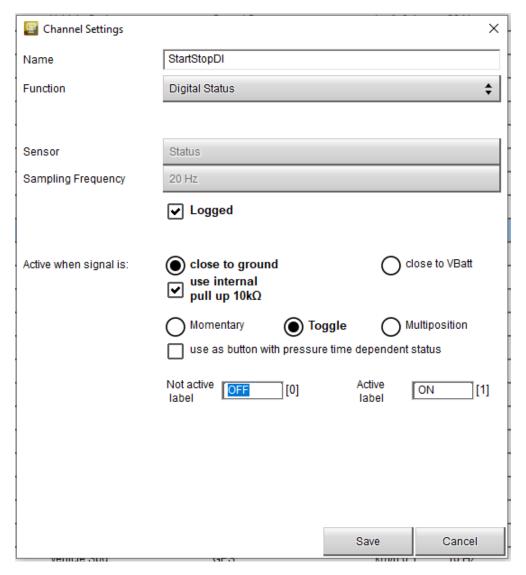

The StartEng SV is setup like this

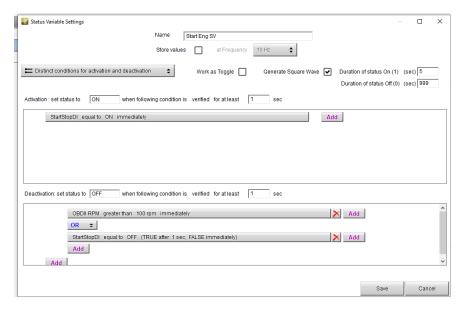

Power to the Starter will be for 5 seconds or less.

Power is withdrawn if RPM is greater than 100, or the StartStop DI is pressed again.

The Starter O is set as shown below.

Modify Output Signal		O	×
High Power Out 1 on Black Connector (35 Pin Male) Pin: 1; 13;			
Name : Starter O			
Settings Related Channels			
Soft Start in a time of 1 sec Maximum Value of Requested Load (up to 20.0 A) 20 A			
Over Current I shrb-Off Time 5			
Number of Retries 1			
PWM based on frequency of 100 Hz. Retry Delay 0.5 sec			
Minimum Current 0 A			
□ Distinct conditions for activation and deactivation □			
Activation : set status to ON when following condition is verified for at least 0 sec			
Start Eng SV equal to ON immediately Add			
OBDIIRPM less than 100 rpm immediately Add			
Add			
Add			
Deadfivation: set status to OFF when following condition is verified for at least 0 sec			
Start Eng SV equal to OFF immediately Add			
	OK	Cano	cel
	Oit	Ouri	

Other equipment which should be on when the engine is on can be set to start on their own output when Start/Run DI is ON, example ECU Power.

To prevent draining of the battery you can have the Alternator start only when RPM is greater than 100.